

# **Capacitive Proximity Sensors**



Capacitive proximity sensors belong to a sort of position sensors. Similar to the structure of a capacitor, the probe of sensor acts as one pole of capacitor and another pole is the sensing object. While the sensing object approaches a proximity sensor, the dielectric constant may change between object and sensor. Meanwhile, this causes the circuit to alter.



#### ООО "РусАвтоматизация"

454010 г. Челябинск, ул. Гагарина 5, оф. 507 тел. 8-800-775-09-57 (звонок бесплатный), +7(351)799-54-26, тел./факс +7(351)211-64-57 info@rusautomation.ru; русавтоматизация.рф; www.rusautomation.ru





#### **Features**




- Plastic thread type and cylinder type; Structure of sensors, durable working, and supply voltage AC/DC available
- Stable Operation: Without adjustable and mechanical components, proximity sensors don't be affected by the qualities of mediums and the variation of density, and it can work immediately after installation
- A variety of size and of outputs, easy installation, user-friendly handling.
- Operating temperature:-25~80(℃); High temperature type:-25~100(℃)
- Protection Classification: IP67
- Certification: CE and RoHS
- Sensing Objects: Solids and liquidsOutput: NPN、PNP、AC、DC、NO、NC
- Display: LED.
- Electric Protection: Overload, short-circuit, reverse polarity

#### **Operating Principle**

Capacitive proximity sensors belong to a sort of position sensors. Similar to the structure of a capacitor, the probe of sensor acts as one pole of capacitor and another pole is the sensing object. While the sensing object approaches a proximity sensor, the dielectric constant may change between object and sensor. Meanwhile, this causes the circuit to alter. The sensing objects of capacitive proximity sensors can be not only metals but also insulting solids, liquids, and powders. When detecting the low-k objects, proximity sensors can enhance the sensitivity by modifying clockwise the multipotentiometer behind the sensors; furthermore, a normal potentiometer makes a capacitive proximity sensor actuate in the position of sensing range by 70%~80%.

The sensing interface of capacitive proximity sensor is composed of two in-line metal electrodes, and it is similar to an open capacitors. These two electrodes constitute a capacitance with a series connection inside theRC oscillatory circuit. When the power is on, the RC oscillator stop working until a sensing object approaches the sensing interface due to the increasing volume of capacitance. Through the comparison between the signals handled by the post-circuit and the internal signals, a capacitive proximity sensor can detect the existence of objects. It can sense not only the metals but also the non-metals; moreover, the sensing range to the metals can acquire maximum value. The sensing range of the non-metals depends on the dielectric constants of the sensing materials. The higher dielectric constant, the longer sensing

#### **Operation Procedure of Capacitive Proximity Sensors**

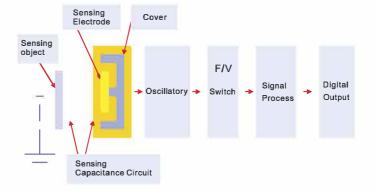

ema Process Automation


**Level Measurement** 

Capacitive Level Switches


#### **Applications**

Capacitive Proximity Sensors can sense metals and non-metals, such as liquids, solids in the funnels, the storage tanks, and the granaries. They are applied extensively in the industry; for example medical, semiconductor, timbering, papermaking, glass, plastics, foods, cement, chemistry engineering, and etc.

#### **Sensing Level of Solids**

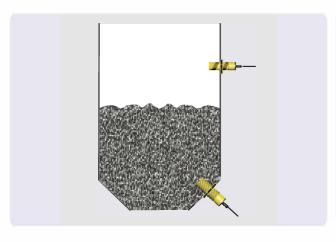

#### **Sensing Level of Liquids**

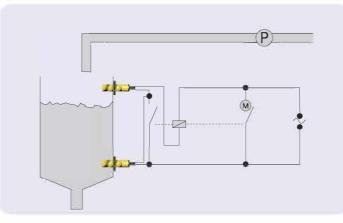


#### Sensitivity adjustment

A Without any target in front of the sensing face, turn the sensitivity potentiometer clockwise until the proximity sensor turns ON (LED light turns on).




C If the difference between ON position and OFF position in B is more than 0.5 turns, the operation sensor is stable.

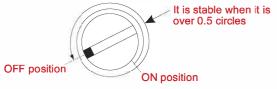

B With a target in front of the sensing face, turn the sensitivity potentiometer anticlockwise from the ON position stated in A until the proximity sensor turns OFF (LED light turns off).



If you set sensitivity potentiometer at center position between ON and OFF position, sensitivity setting is completed.

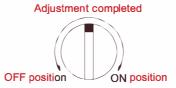


- \* When there is distance fluctuation between proximity sensor and target, please adjust B with target at farthest from this unit.
- \* Turning potentiometer clockwise is maximum and turning anticlockwise it is minimum. Number of adjustment should be 6 ± 2 revolution and if you turn right or left excessively, it is non-stop.





Connection						
Electric Design	Connection	Wiring/Core Color	Connection			
2-Wire	2M PVC	BN Brown BU Blue	3 BU N L-			
	M12 Socket	WH white BN Brown  2  4  BU Blue BK Black	3 BU 3 BU 3 L+			
	2M PVC	BN Brown BU Blue BK Black	PNP connection  BN  L+  4  BK  3  BU  L-  NPN connection  BN  L+  4  BK  3  BU  L-			
3-Wire	M12 Socket	WH white BN Brown  BN Brown  BN Brown  BN Brown  BN BROWN  BN BROWN	PNP connection  BN  L+  BK  BBH  L-  NPN connection  BN  L+  ABH  BH  L-  NPN connection  BN  L+			

#### The relationship of object material and detecting distance

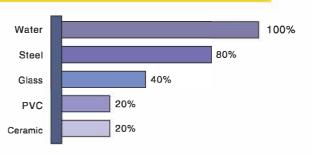

## Accessories

Туре	Connector Order No.					
THE STATE OF THE S	С	02	L	5	С	12
1 L	C: Cable	Length 02: 2M 05: 5M 10: 10M	Connector I: Straight L: Angled	Pole 4: 4 5: 5	Material R:PUR C:PVC S:PVC shielded wire	Size 12: M12

Capacitive Level Switches

Туре		Socket				
Order No.	US0013	US0014	US0015	US0016		
Socket						
Spec.	M12 Straight, 4-Pole, Female	M12 Angled, 4-Pole, Female	M12 Straight, 4-Pole, Male	M12 Angled, 4-Pole, Male		
Drawing No.	2 39/59 9	1 81 [41.00] REF. 10 CASIL RANGE 1 161 [41.00] 1 161 [41.00] 1 161 [41.00]	2 116 [58.74]	1.81 (41.00)  1.81 (41.00)  1.81 (41.00)  1.82 (41.00)  1.82 (41.00)  1.82 (41.00)  1.83 (41.00)  1.84 (41.00)		

Size	M18				
Specification	Cable				
Sensing Range	8mm	8mm			
four wire PNP connection					
four wire NPN connection    IBN	(K RoHS	SHE Anti-corrosive			
Three wire PNP NO	CA0004				
Three wire PNP NC	CA0005				
Three wire NPN NO	CA0006				
Three wire NPN NC	CA0007				
Four wire PNP NO/NC		CA0018			
Four wire NPN NO/NC		CA0012			
Sensing Surface	Non-flush	Non-flush			
Operating voltage [V]	10~36DC	10~36DC			
Current loading [mA]	250	250			
Short-circuit protection	Pulse	Pulse			
Reverse polarity protection	YES	YES			
Overload protection	YES	YES			
Voltage drop [V]	< 2.5	< 2.5			
Consumed current [mA]	< 13(24VDC)	< 13(24VDC)			
Real sensing range [mm]	8 ± 10%	8 ± 10%			
Operating range [mm]	0~6.5	0~6.5			
Switch-point drift [%/Sr]	<b>-15~15</b>	-15~15			
Hysteresis [%/Sr]	1~15	1~15			
Switching frequency [Hz]	40	40			
Operating temperature [℃]	-25~80	<b>−25~80</b>			
Protection classification	IP67	IP67			
Adjustment factors		amic approx .0.2 / PVC approx.0.2			
Housing material	PBT+GF	PP+GF			
Switching state display LED	Red(90°)	Red(90°)			
Connection	PVC-Cable /2m;3x0.34mm²	PVC-Cable /2m;4x0.34mm²			
Accessary	Fixed nut and screw driver				
Dimensions (mm)	MSXI B B B B B B B B B B B B B B B B B B B	MISUL LED			

ema Process Automation

Level Measurement

CA
M18

Size	M18			
Specification	Cable			
Sensing Range	8mm	8mm		
	(É RDHS	(6 RoHS		
Two wire AC/DC NO	CA0001			
Two wire AC/DC NC	CA0002			
Two wire DC NO/NC		CA0008		
Sensing Surface	Non-flush	Non-flush		
Operating voltage [V]	20~250AC	10~36DC		
Current loading (continuous) [mA]	250(~50℃)/200(~70℃)	250		
Current loading (peak) [mA]	1.5 A( 20 ms / 0.5 Hz)			
Minimum current loading [mA]	5			
Short-circuit protection	NO	Pulse		
Reverse polarity protection	NO	YES		
Overload protection	NO	YES		
Voltage drop [V]	< 10 AC / < 8 DC	<4.6		
Leakage current [mA]	< 2.5(250 V AC)/ < 1.7(110 V AC) / < 1.5(24 V DC)	< 1(24VDC)		
Real sensing range [mm]	8 ± 10%	8 ± 10%		
Operating range [mm]	0~6.5	0~6.5		
Switch-point drift [%/Sr]	-15~15	-15~15		
Hysteresis [%/Sr]	1~15	1~15		
Switching frequency [Hz]	25AC / 40DC	40		
Operating temperature [°C]	-25~80	-25~80		
Protection classification	IP67	IP67		
Adjustment factors	Water=1 / Glass approx.0.4 / Ceram	ic approx .0.2 / PVC approx.0.2		
Housing material	PBT+GF	PBT+GF		
Switching state display LED	Red(90°)	Red(90°)		
Connection	PVC-Cable /2	m;2x0.34mm²		
Accessary	Fixed nut and	d screwdriver		
Dimensions (mm)	MEAN TO SO	A ZE		

Size	M30		
Specification	C	able	Connector
Sensing Range	15mm	15mm	15mm
	SHOR CO. ROLD	Auticotros de la contros de la	SHAR (¢ Rots
Three wire PNP NO	CB0004		CB0012
Three wire PNP NC	CB0005		CB0013
Three wire NPN NO	CB0006		CB0014
Three wire NPN NC	CB0007	A	CB0015
Four wire PNP NO/NC		CB0018	
Four wire NPN NO/NC		CB0022	
Sensing Surface	Non-flush	Non-flush	Non-flush
Operating voltage [V]	10~36DC	10~36DC	10~36DC
Current loading [mA]	250	250	250
Short-circuit protection	Pulse	Pulse	Pulse
Reverse polarity protection	YES	YES	YES
Overload protection	YES	YES	YES
Voltage drop [V]	< 2.5	< 2.5	< 2.5
Consumed current [mA]	< 13(24VDC)	< 13(24VDC)	< 13(24VDC)
Real sensing range [mm]	15 ± 10%	15 ± 10%	15 ± 10%
Operating range [mm]	0~12	0~12	0~12
Switch-point drift [%/Sr]	-15~15	-15~15	-15~15
Hysteresis [%/Sr]	1~15	1~15	1~15
Switching frequency [Hz]	40	40	40
Operating temperature [℃]	-25~80	-25~ 80	-25~80
Protection classification	IP67	IP67	IP67
Adjustment factors	Water=1 / Glass	s approx.0.4 / Ceramic approx .0.	2 / PVC approx.0.2
Housing material	PBT+GF	PP+GF	PBT+GF
Switching state display LED	Red(90°)	Red(90°)	Red (90°)
Connection	PVC-Cable /2m;3x0.34mm²	PVC-Cable /2m;4x0.34mm²	M12 connector
Accessary		Fixed nut and screwdriver	
Dimensions (mm)	SEN	WSGCS STATE OF THE PARTY OF THE	KSOLS  KSOLS  LED  4X  4X

ema Process Automation

Level Measurement

CB

M30

CC Level Measurement Ф34

Size	M30				
Specification	Cable	Connector			
Sensing Range	15mm	15mm			
	SHOR WOLKS	SHOR SY			
Two wire DC NO/NC	CB0008	CB0016			
Sensing Surface	Non-flush	Non-flush			
Operating voltage [V]	10~36DC	10~36DC			
Current loading (continuous)	250	250			
Short-circuit protection	Pulse	Pulse			
Reverse polarity protection	YES	YES			
Overload protection	YES	YES			
Voltage drop [V]	< 4.6	< 4.6			
Leakage current [mA]	< 1(24VDC)	<1(24VDC)			
Real sensing range [mm]	15 ± 10%	15 ± 10%			
Operating range [mm]	0~12	0~12			
Switch-point drift [%/Sr]	-15~15	-15~15			
Hysteresis [%/Sr]	1~15	1~15			
Switching frequency [Hz]	40	40			
Operating temperature [ $^{\circ}$ C]	<b>-25~80</b>	-25~80			
Protection classification	IP67	IP67			
Adjustment factors	Water=1 / Glass approx.0.4 / Cera	amic approx .0.2 / PVC approx.0.2			
Housing material	PBT+GF	PBT+GF			
Switching state display LED	Red(90°)	Red(90°)			
Connection	PVC-Cable /2m;2x0.34mm <sup>2</sup>	M12 connector			
Accessary	Fixed nut and screwdriver				
Dimensions (mm)	KSINIS LET	N,SERIO, S.			

Size	Ф34				
Specification	Cable	Connector			
Sensing Range	20mm	20mm			
	RoHS (K. Bohs)	SHOR SOLE CE BOHS			
Three wire PNP NO	CC0004	CC0012			
Three wire PNP NC	CC0005	CC0013			
Three wire NPN NO	CC0006	CC0014			
Three wire NPN NC	CC0007	CC0015			
Sensing Surface	Non-flush	Non-flush			
Operating voltage [V]	10~36DC	10~36DC			
Current loading [mA]	250	250			
Short-circuit protection	Pulse	Pulse			
Reverse polarity protection	YES	YES			
Overload protection	YES	YES			
Voltage drop [V]	<2.5	<2.5			
Consumed current [mA]	< 13(24VDC)	< 13(24VDC)			
Real sensing range [mm]	20 ± 10%	20 ± 10%			
Operating range [mm]	0~16	0~16			
Switch-point drift [%/Sr]	<b>-15~15</b>	-15~15			
Hysteresis [%/Sr]	1~15	1~15			
Switching frequency [Hz]	40	40			
Operating temperature [℃]	-25~80	<b>-25~80</b>			
Protection classification	IP67	IP67			
Adjustment factors		Ceramic approx .0.2 / PVC approx.0.2			
Housing material	PBT+GF	PBT+GF			
Switching state display LED	Red(90°)	Red(90°)			
Connection	PVC-Cable /2m;3x0.34mm²	M12 Connector			
Accessary	Fixed nut and	d screwdriver			
Dimensions (mm)		958 6 343 10 10 10 10 10 10 10 10 10 10 10 10 10 1			

ema Process Automation

Size

Specification

Two wire DC NO/NC

Operating voltage[V]

Overload protection

Leakage current[mA]

Operating range[mm]

Hysteresis[%/Sr]

Switch-point drift [%/Sr]

Switching frequency [Hz]

Protection classification

Adjustment factors

Housing material

Dimensions(mm)

Connection

Accessary

Operating temperature[°C]

Switching state display LED

Real sensing range[mm]

Voltage drop[V]

Current loading (continuous)
Short-circuit protection

Reverse polarity protection

Sensing Surface

Sensing Range

Level Measurement

Cable

20mm

CC0008

Non-flush

10~36DC

250mA

Pulse

YES

YES

< 4.6

< 1(24VDC)

 $20 \pm 10\%$ 

0~16

-15~15

1~15

40

-25~80

IP67

PBT+GF

Red(90°)

PVC-Cable /2m;2x0.34mm<sup>2</sup>

СС Ф34

Ф34

Water=1 / Glass approx.0.4 / Ceramic approx .0.2 / PVC approx.0.2

Fixed nut and screwdriver

Connector

20mm

CC0016

10~36DC

250mA

Pulse

YES

YES

< 4.6

< 1(24VDC)

 $20 \pm 10\%$ 

0~16

-15~15

1~15

40

-25~80

IP67

PBT+GF

Red(90°)

M12 Connector

Non-flush

3

CD Level Measurement
One touch smart sensor

ema Process Automation

Size		35 × 70mm			
Specifica	ation	Cable			
Sensing Range			25mm	25mm	
		(€ RoHS	GONDA CONTROL OF THE	(6 RoHS	
Three wire	PNP NO/NC		CD0001		
Three wire	PNP NO/NC			CD0002	
Sensing S	urface		Non-flush	Non-flush	
Operating	voltage [V]		10~36VDC	10~36VDC	
Current loa	ading [mA]		200mA	200mA	
Short-circu	uit protection		Pulse	Pulse	
Reverse po	olarity protection	YES YES		YES	
Overload p	protection	YES YES			
Voltage dro	op [V]	< 2.5		< 2.5	
Consumed	current [mA]	<	: 30(24VDC)	< 30(24VDC)	
Realsensi	ng range [mm]		25 ± 10%	25 ± 10%	
Operating	range [mm]		0~20	0 ~20	
Switch-poi	int drift [%/Sr]		-15~15	-15~ 15	
Hysteresis	[%/Sr]		1~15	1 ~15	
Switching	frequency [Hz]		5	5	
Operating	temperature [℃]		-25~80	−25~ 80	
Protection	classification		IP67	IP67	
Adjustmen	nt factors	Water=1 / Glass approx.0.4 / Ceramic approx .0.2 / PVC approx.0.2			
Housing m	naterial		PA+GF		
Function	Switching state LED	Yel	low(90°)	Yellow(90°)	
display	Operating LED		een(90°)	Green(90°)	
	Function LED		ed(90°)	Red(90°)	
Connection			PVC-Cable /2m;	3x0.34mm²	
Dimensions(mm)		35.0 27.0 4 3.5	73.0	35.0 2770 15.0 27.4 16.6 3.5	

### ema Process Automation


#### **Level Measurement**


Capacitive Level Switches


## Installation


Туре	Mounting	Mounting Size	Mounting Direction
CA	Standard Mounting ( with nut)	1、Nut: M18×1 2、Vent: 18.2 <d<22(mm) 3、non-flash="" mounting<="" td=""><td></td></d<22(mm)>	
СВ	Standard Mounting (with nut)	1、Nut: M30×1.5 2、Vent: 30.2 <d<34(mm) 3、Non-flash mounting</d<34(mm) 	
cc	Mounting Clamp	1. Vent: 34.2 <d<40(mm) 2.="" 3.="" bolt:="" fixed="" m5="" mounting<="" non-flash="" td=""><td></td></d<40(mm)>	
CD	Fixture Wire	Mount the wire through the holes of sensor, and fix it to the tube.	

## **Installation Notice**

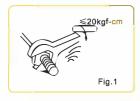

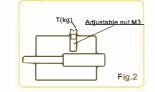

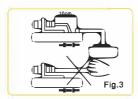

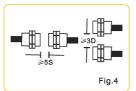

- Mounting for thread type :Don`t twist the torgue too hard (Fig.1)
- Mounting for cylinder type: To adjust the fixed screw and keep the torque in the range of 2-4kgf-cm. (Fig. 2)
- Lead protection: Please fasten the lead which is located 10cm far away the sensor by a clip in order to avoid the damage of sensor resulted from the lead affected by an external force. (Fig. 3)
- To prevent the mutual influences between the sensors: When mounting in facing way or apposed way, please follow the instruction in Fig.4 to avoid of the false operation from the mutual influences.
- Notice: S: Sensing distance D:Sensor diameter